


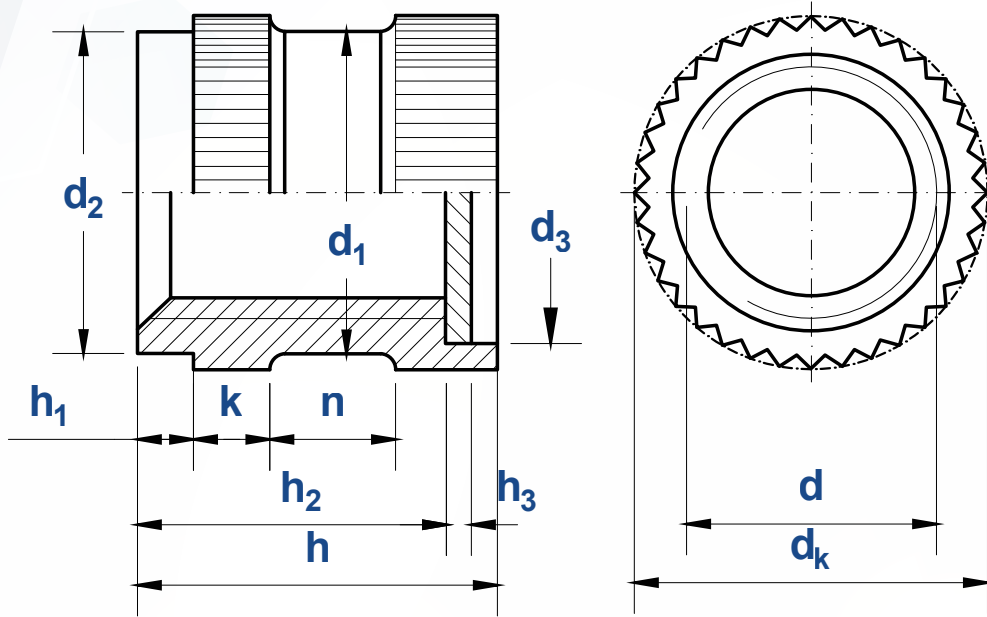

Type H

Screw Thread d		M2	M2.5	M3	(M3.5)	M4	M5	M6
k		1	1.2	1.2	1.5	1.5	2	2.5
h ₁		0.8	0.8	1	1	1	1	1
n		1.5	1.6	1.8	2.2	2.5	3	3.5
h ₃		0.32	0.32	0.32	0.5	0.5	0.5	0.5
d ₁	(h12)	3.2	3.4	3.8	4.5	5	6.4	7.4
d _k	(before knurling)	3.5	3.8	4.2	5	5.5	7	8
d ₂	(h11)	3.5	3.8	4.2	5	5.5	7	8
d ₃	(D11)	2.6	2.8	3.2	3.8	4.5	6	7
h ₂	(h14)	3.5	4	4.5	5.5	6	7.5	9
h	(h12)	4.3	4.8	5.3	6.5	7	8.5	10