


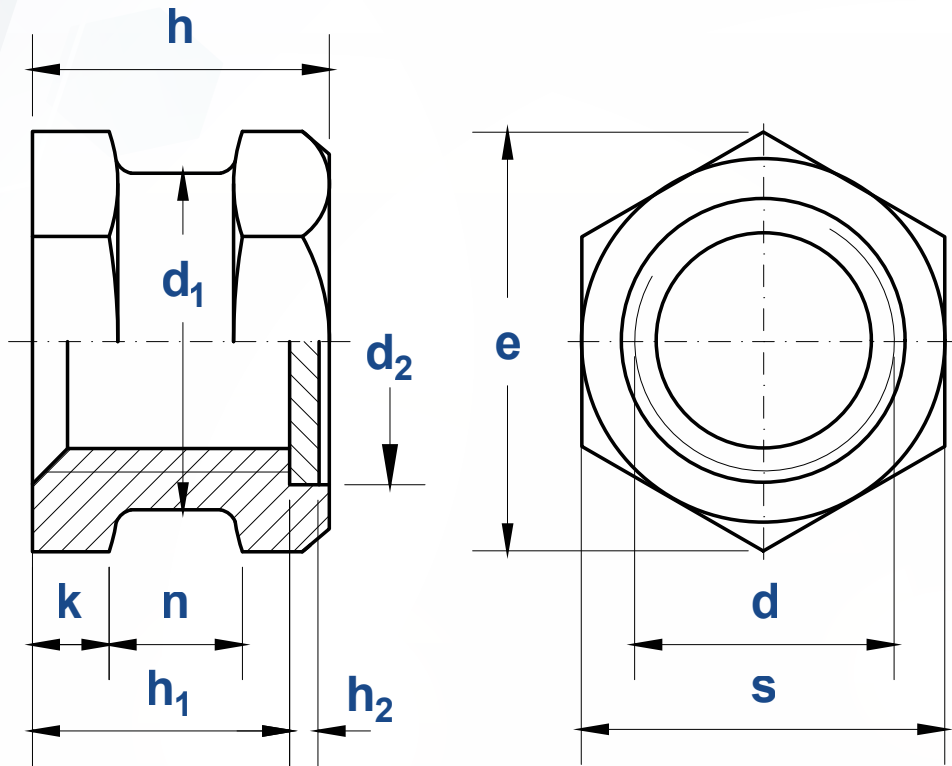

Screw Thread d		M3	(M3.5)	M4	M5	M6	M8	M10	M12
k		1.2	1.4	1.4	1.5	1.8	2.5	3	3.5
n		1.5	1.8	2.2	2.5	3.2	3.8	4.5	5.5
h_2		0.32	0.5	0.5	0.5	0.5	1	1	1
d_1	h_{12}	3.8	4.5	5	6.4	7.4	10.4	13	17
d_2	(D11)	3.2	3.8	4.5	6	7	9	11	13
e	$\approx$	5.8	6.1	6.9	8.1	10.4	12.7	16.2	21.9
h_1	(h_{14})	3	3.5	4	5	6	8	10	12
h	(h_{12})	3.8	4.5	5	6	7	9.5	11.5	13.5
s		5	5.5	6	7	9	11	14	19